


# Arctic Cat® Wildcat

## Installation Instructions - Service Parts

### 4P Map Connector Repair Kit

(p/n 1436-484)

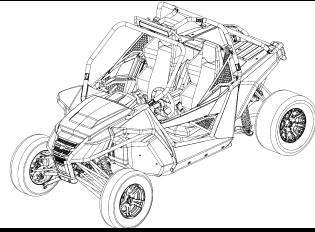

■ **NOTE:** Read these Installation Instructions thoroughly before beginning the installation process. Retain these Installation Instructions for future reference.

#### Application: Wildcat

##### Kit includes:

p/n	QTY	DESCRIPTION
0430-092	4	Splice Connector
0486-461	1	Repair Harness
0453-798	1	Instruction

■ **NOTE:** Refer to the 2012 Wildcat Service Manual for more detailed instructions.

1. Disconnect both battery cables from the battery; then disconnect the connector from the throttle body. See Fig. 1.

Fig. 1



ROV-167A

2. Remove the tape and loom from the wires; then cut the four harness leads using a wire cutter approximately two to three inches from the damaged connector. See Fig. 2.

Fig. 2



ROV-166A

3. Using a wire stripper, removed 3/8-in. of the insulation from the leads coming from the main harness.

■ **NOTE:** With the insulation removed, the copper wire strands must be clean before proceeding. If not, use fine sandpaper to remove any corrosion.

4. Attach Repair Harness to the throttle body; then cut off the leads at the desired length. Leave enough extra wire to allow for a couple inches of slack.

5. Using a wire stripper, removed 3/8-in. of the insulation from the leads coming from the repair harness.

■ **NOTE:** When connecting the repair harness to main harness, make sure all wires colors match.

6. Insert a wire into either end of the splices until the stripped ends are through the solder ring in the splice center.

7. Using a heat gun, heat the splice until the solder ring melts into the two wire lead ends. Allow to cool before applying any pressure to the leads.

8. Install the existing loom and secure using electrical tape; then connect the connector to the throttle body.

9. Connect both battery cables to the battery.

