


Arctic Cat® Wildcat

Usage Instructions

Headlight Connector Repair Kit (p/n 1436-487)

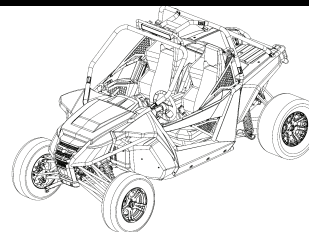

■ **NOTE:** Read these Usage Instructions thoroughly before beginning the installation process. Retain these Usage Instructions for future reference.

Kit includes:

p/n	QTY	DESCRIPTION
0486-463	1	Repair Harness
0453-093	3	Splice Connector
0453-788	1	Instructions

1. Using a wire cutter, cut the three main harness leads approximately three to four inches from the damaged headlight connector.
2. Using a wire stripper, remove 1/4-in. of the insulation from the three wire leads coming from the main harness.

■ **NOTE:** With the insulation removed, the copper wire should be clean. If not, use fine sandpaper to remove any corrosion.

3. Attach Repair Harness connector to the headlights.
4. Attach the three repair harness leads to the main harness leads using Splice Connectors.
5. Insert a wire into either end of the splice until the stripped ends are through the solder ring in the splice center.
6. Using a heat gun, heat the splice until the solder ring melts into the two wire lead ends. Allow to cool before applying any pressure to the leads.

